

CUTTING WEDGE WEAR EXAMINATION DURING TURNING OF DUPLEX STAINLESS STEEL

Grzegorz Królczyk, Stanisław Legutko, Pero Raos

Original scientific paper

The purpose of the study was to determine the coated carbide tool surface topography. The study included determining detailed identification of wear mechanisms occurring on the rake face and major flank in the process of turning the DSS. The results of wear occurring on the tool both points were compared for the period of the steady-state wear of the tool point. Occurrence of various mechanisms, such as abrasive wear, was proven. Scanning Electron Microscopy SEM and Infinite Focus optical device for 3D surface measurement were used for the wear analysis.

Keywords: Duplex Stainless Steel (DSS), machining, turning, surface layer, tool wear

Analiza trošenja reznog klina alata pri tokarenju duplex nehrđajućeg čelika

Izvorni znanstveni članak

Rad se bavi analizom topografskih karakteristika karbidne površine reznog alata. Istraživanjem je obuhvaćena detaljna analiza mehanizma trošenja rezne oštrice i prednje površine alata u procesu tokarenja duplex nehrđajućeg čelika. U stabilnom režimu uočeno je trošenje oba analizirana dijela reznog alata. Dokazana je pojava različitih mehanizama trošenja, primjerice abrazivskog trošenja. Trošenje površine analizirano je s pomoću elektronske pretražne mikroskopije (SEM) i optičkog uređaja *Infinite Focus* za trodimenzijsko mjerenje površina.

Ključne riječi: Duplex nehrđajući čelik, obrada odvajanjem čestica, tokarenje, površinski sloj, trošenje alata

1 Introduction

Duplex stainless steel is widely used for many industrial applications due to its unique properties. Good combination of its mechanical properties (high strength and toughness) and corrosion resistance makes it of great interest for a wide range of applications especially in the oil, chemical and power industry [1, 2]. However, machinability of the material is considered to be poor due to its inherent characteristics. The DSS machinability studies have not rendered a clear answer to the question how the cutting speed influences the condition of the cutting wedge [3, 9]. The wear of the cutting wedges is to be considered one of the most important problems of machining process investigation [4]. The contact phenomena on the tool flank surface are of interest because understanding them allows the explanation of tool flank wear and the formation of surface integrity of machined surfaces on workpieces. Nevertheless, there are few known studies available on the subject [5]. Machining costs are determined mostly by the time which is necessary for measuring and machining. Demands for higher productivity and a better use of cutting tools lead to a combination of machining parameters [6]. The investigation presented in the paper answers the question

what happens to the cutting wedge considering the form of its wear.

2 Research approach and experimental procedure

2.1 Workpiece and cutting wedge materials

Machined material was 1.4462 (DIN EN 10088-1) steel with a ferritic-austenitic structure containing about 50 % of austenite. The ultimate tensile strength $R_m = 700$ MPa, Brinell hardness - 293 HB. The elemental composition of the machined material and technical details of the cutting tools are stated in Tab. 1 and Tab. 2 [9], respectively. Cutting tool inserts of TNMG 160408 designation clamped in the tool shank of ISO-MTGNL 2020-16 type were employed.

The examination of the wedges was performed after a time of cutting corresponding to 30 % of the tool life period. The measurements and analysis were performed on cutting wedges working without the use of a coolant-lubricant at cutting speeds of $v_c = 50$ m/min and 150 m/min, $f = 0,3$ mm/rev, $a_p = 2$ mm. The study was performed within a production facility. The investigation program was carried out on a CNC 400 Famot lathe – Pleszew.

Table 1 Chemical composition of 1.4462 duplex stainless steel

Element	C max	Si max	Mn max	P max	S max	Cr	Ni	Mo	N	Others
% wt.	0,03	1,00	2,00	0,030	0,020	21,0 23,0	4,50 6,50	2,50 3,50	0,10 0,22	-

Table 2 Cutting tool data

Tool	Substrate	Others
W1 MM 2025	Hardness: 1350 HV3 Grade: M25, P35	Coatings: Ti(C,N)-(2 μm) (Top layer) Al ₂ O ₃ -(1,5 μm) (Middle layer) TiN-(2 μm) (Bottom layer) Coating technique: CVD


2.2 Wear and wedge topography investigations

After cutting trials, the values $V_{B_B} = 0,14$ mm of flank wear were measured with the use of an Infinite Focus Measurement Machine (IFM) [7]. IFM is an optical 3D measurement device which allows the acquisition of datasets at a high depth of focus. The IFM 3.2 software version was used for the measurements. The surfaces of indexable tool inserts were verified using an ESEM TMP scanning electron microscope.


3 Results and discussions

3.1 Tool wear analysis

The cutting wedge working at the cutting speed of $v_c = 150$ m/min was subjected to measurements by means of an Infinite Focus device [7]. The examination consisted of the measurement of the wedge wear parameters on the rake face and determination of the cutting edge shape. In order to compare the cutting wedge wear, a new wedge was also measured to assemble the results and determine the dimensional differences. The compared results were to help us to determine the values of the wear parameters on the rake face of the cutting wedge and the character of the wedge wear depending on the cutting speed.

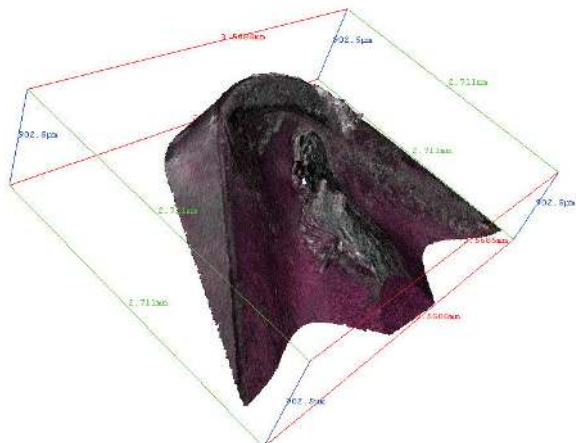

a) Rake face of the tool point W1 in real colour ($v_c = 150$ m/min, $f = 0,3$ mm/rev, $a_p = 2$ mm, dry)

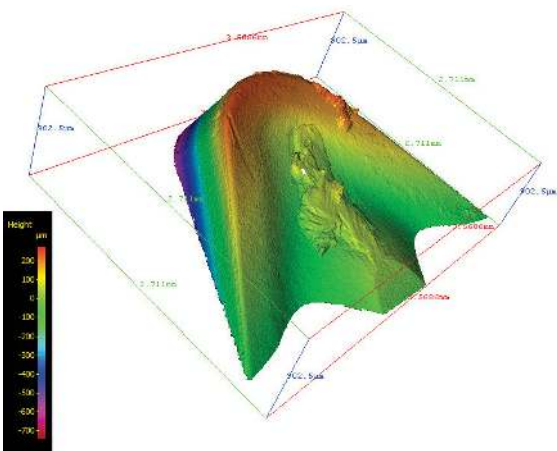

b) Rake face of the tool point W1 in pseudo colour ($v_c = 150$ m/min, $f = 0,3$ mm/rev, $a_p = 2$ mm, dry)

Figure 1 Topography of W1 tool wear during turning of DSS steel for $v_c = 150$ m/min

The results of stereometry visualization of a cutting wedge working at cutting speed of 150 m/min are shown in Fig. 1. In the photographs, one can see a built-up edge on the rake face located next to the main cutting edge and between the main cutting edge and the chip breaker.

In order to determine the dimension differences between the individual wedges, two sets of 3D digital data of the cutting wedge geometrical structure were compared. The magnitudes characterizing the wedge geometry were measured and the surface structure photographed. The wedge surface structure photographs and its dimensions were subjected to analysis which could be divided into the following three steps:

- alignment of two 3D-datasets
- the depicted 3D-difference Dataset (Fig. 2)
- visualized result data in a histogram.

Values calculated in this measurement were:

- mean deviation
- max deviation
- min deviation.

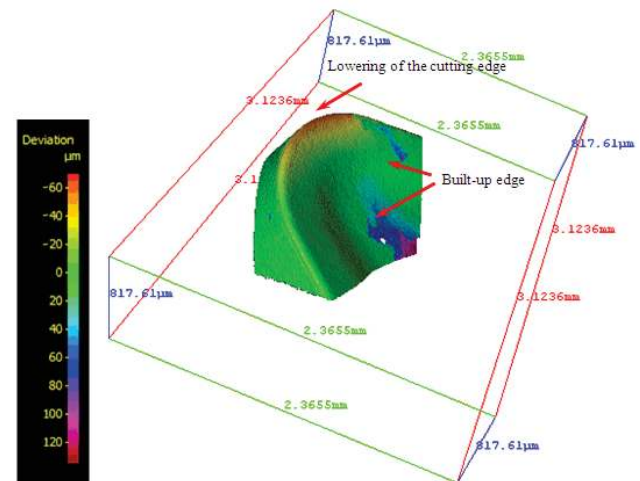


Figure 2 Overlaid models of selection (region under investigation), deviations displayed in pseudo colours

As can be seen in Fig. 2 showing the differences between unworn wedge working at the cutting speed of 150 m/min and that of an idle wedge, cutting edge lowering by $30 \div 50 \mu\text{m}$, as well as the previously described built-up edge, are visible. The measurement results were as follows:

- mean deviation $-2,865 \mu\text{m}$,
- max. deviation $70,432 \mu\text{m}$,
- min. deviation $-135,26 \mu\text{m}$.

Those results allow for the statement that machining duplex steel at the speed of 150 m/min in the time of 30 % tool life causes significant lowering of the cutting edge, locally in excess of $70 \mu\text{m}$, as well as a large built-up edge of maximum $135 \mu\text{m}$. The mean deviation was $2,865 \mu\text{m}$, which indicates significant wear of the cutting wedge and the prevalence of built-up edge over abrasion. Figure 3 shows a histogram of the distribution of vertices and upgrades located on the cutting wedge. It can be seen that the distribution is even. This proves that the 30 % tool life period is within the so called second stage of the cutting edge wear.

The measurement of the cutting edge rounding radius consisted in virtual cutting of the sample. The trajectory in the optical image was defined in order to obtain the desired 3D view of the profile. By means of basic geometrical tools, such as circles or angles, manual and

semi-automatic measurements were performed. The examinations included the following steps:

- profile extraction with different width,
- manual cursor measurement,
- fitting of primitive geometrical forms.

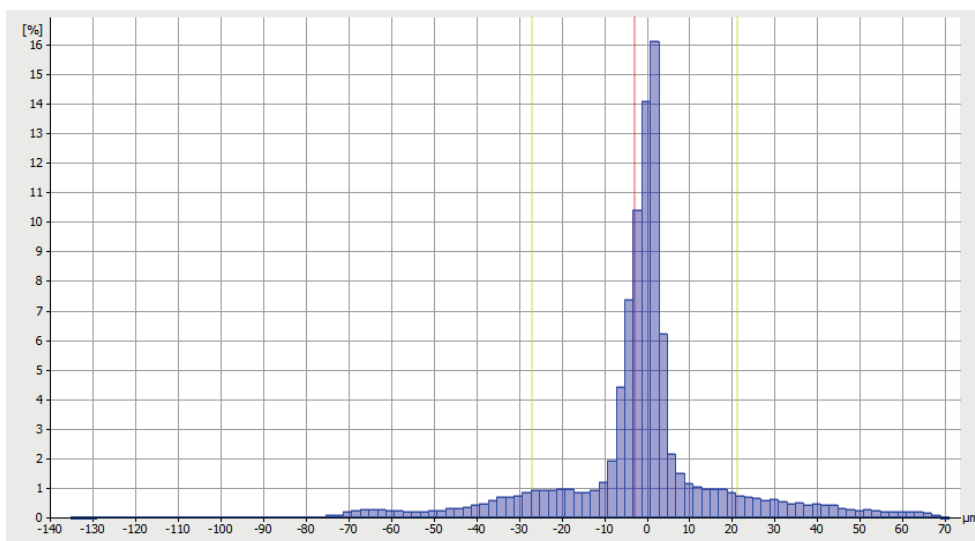


Figure 3 Deviation values tool wear histogram during turning of DSS for $v_c = 150$ m/min

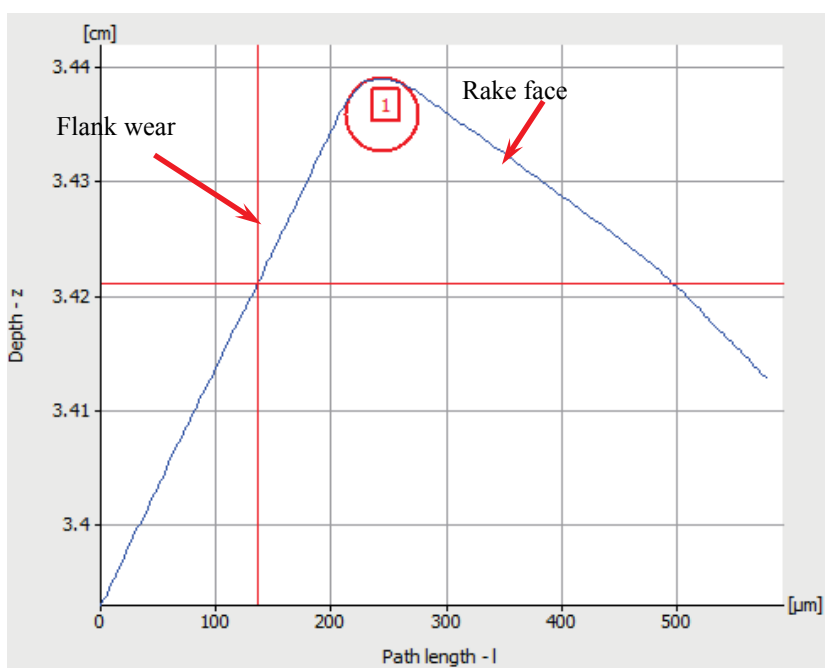


Figure 4 Extracted profile of cutting wedge during turning of DSS for $v_c = 150$ m/min


Fig. 4 shows an extracted cutting wedge profile together with matched geometry. The cutting plate acc. to PN-ISO 1832:1998 [8] is designated E (E – rounded shape). Therefore it has the cutting edge radius r_n .

In order to determine the influence of machining parameters on the form of the cutting wedge wear, tests with the cutting speed reduced to 50 m/min were performed. As in the case of the wedge working at 150 m/min, the surface topography was measured on the rake face, as well as the rounding radius of the cutting edge r_n . Like in the case of the wedge working at the cutting speed of 150 m/min, a new wedge was measured for comparison, the geometrical structures of the two were compared to determine the differences.


The cutting wedge surface topography after turning duplex steel at the cutting speed of 50 m/min is shown in Fig. 5. The built-up edge on the rake face is located as in the case of the wedge working at the cutting speed of 150 m/min, next to the main cutting edge, but with significantly smaller dimensions. One can also see the place of chip friction between the main cutting edge and the chip breaker together with a small built-up edge.

In order to find the dimensional differences between a wedge working at the cutting speed of 50 m/min and an unworn one, two digital images of the wear form of the cutting edges were compared. The result of the comparison of the cutting wedges is the built-up edge, dimensions shown in Fig. 6. One can see less intensive

formation of built-up edge next to the main cutting edge than in the case of the wedge working at the cutting speed of 150 m/min. During the operation of the wedge at the reduced speed, lowering of the cutting edge did not occur, but an abrasion wear land was found on the rake face at the location of chip friction.

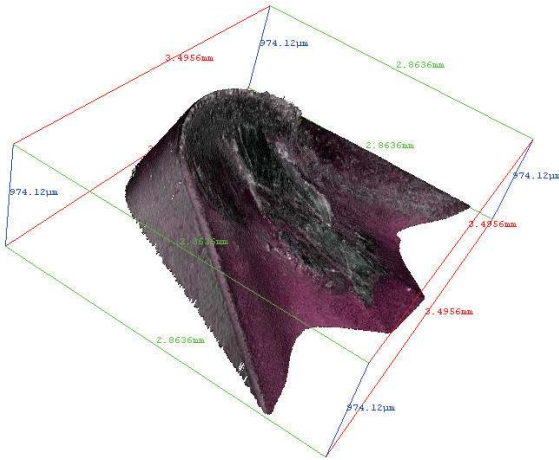

a) Rake face of the tool point W1 in real colour
($v_c = 50$ m/min, $f = 0,3$ mm/rev, $a_p = 2$ mm, dry)

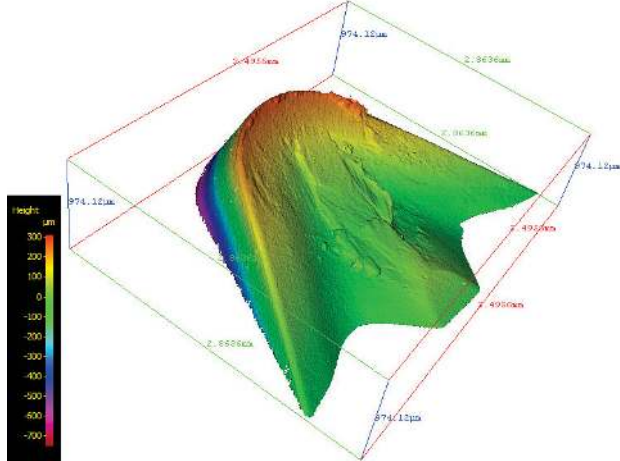

b) Rake face of the tool point W1 in pseudo colour
($v_c = 50$ m/min, $f = 0,3$ mm/rev, $a_p = 2$ mm, dry)

Figure 5 Topography of W1 wedge wear during turning of DSS steel for $v_c = 50$ m/min

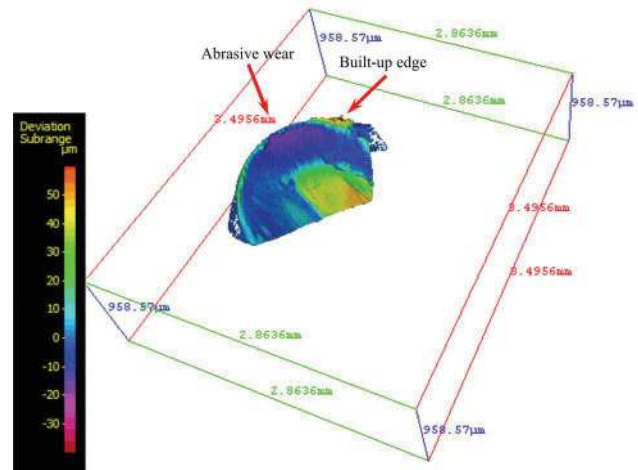


Figure 6 Overlaid models of selection (region under investigation), deviations displayed in pseudo colours

The measurement results were as follows:

- mean deviation $-5,1034 \mu\text{m}$
- max. deviation $88,492 \mu\text{m}$
- min. deviation $-117,71 \mu\text{m}$.

Those results allow for the statement that the reduction of the cutting speed within the examined range of parameters of machining duplex steel results in a decrease of built-up edge on the rake face and eliminates lowering of the cutting edge. The mean deviation on the rake face of wedge no. 4 was $-5,1034 \mu\text{m}$ while, at the same time, in the case of a wedge working at the cutting speed of 150 m/min, the value was $-2,865 \mu\text{m}$. Fig. 7 shows a histogram of the distribution of vertices and upgrades on the cutting wedge. In the figure one can see even distribution in the part from -20 to about $15 \mu\text{m}$. Surface irregularities with the height of $40 \div 50 \mu\text{m}$ are about 2 % of the total number of irregularities. It can be seen that the cutting edge differs from the edge of the wedge working at the cutting speed of 150 m/min. Lowering of the cutting edge, on the other hand, has not been observed. Fig. 8 shows an extracted profile of a cutting wedge working at the speed of 50 m/min.

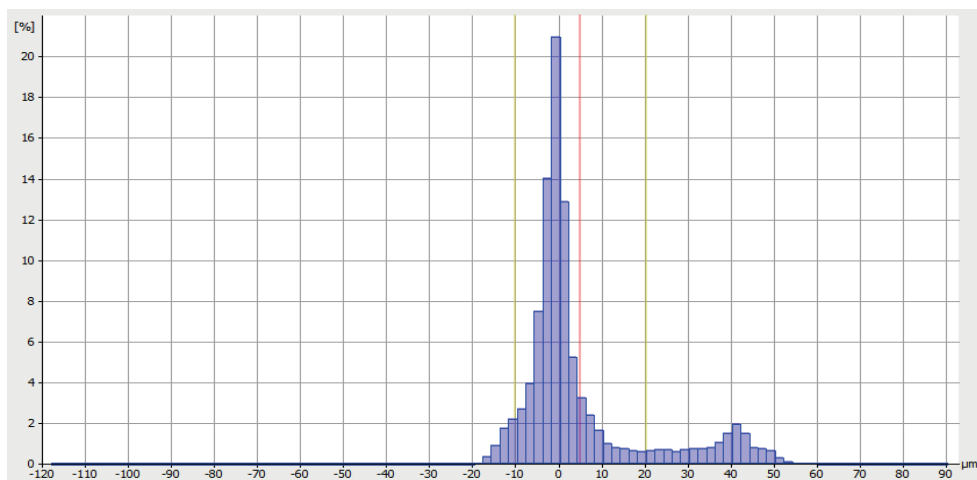


Figure 7 Deviation values tool wear histogram during turning of DSS for $v_c = 50$ m/min

Based on the measurement of the geometry presented in Fig. 8, it was determined that the radius of the cutting

edge rounding r_n was $42,418 \mu\text{m}$. This confirms that machining of duplex stainless steel at higher speeds of the

order of 150 m/min causes lowering of the cutting edge, which is probably due to higher temperatures in the process of turning.

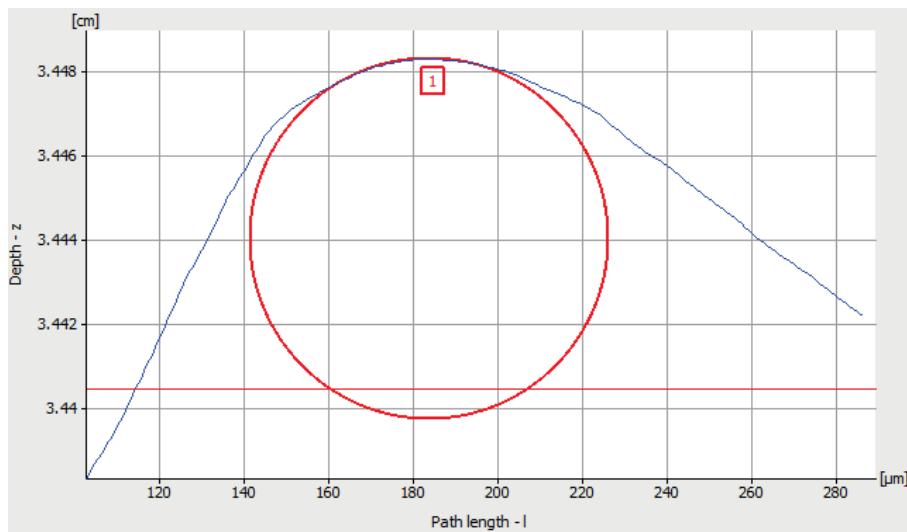


Figure 8 Extracted profile of cutting tool during turning of DSS for $v_c = 50$ m/min – zoomed in

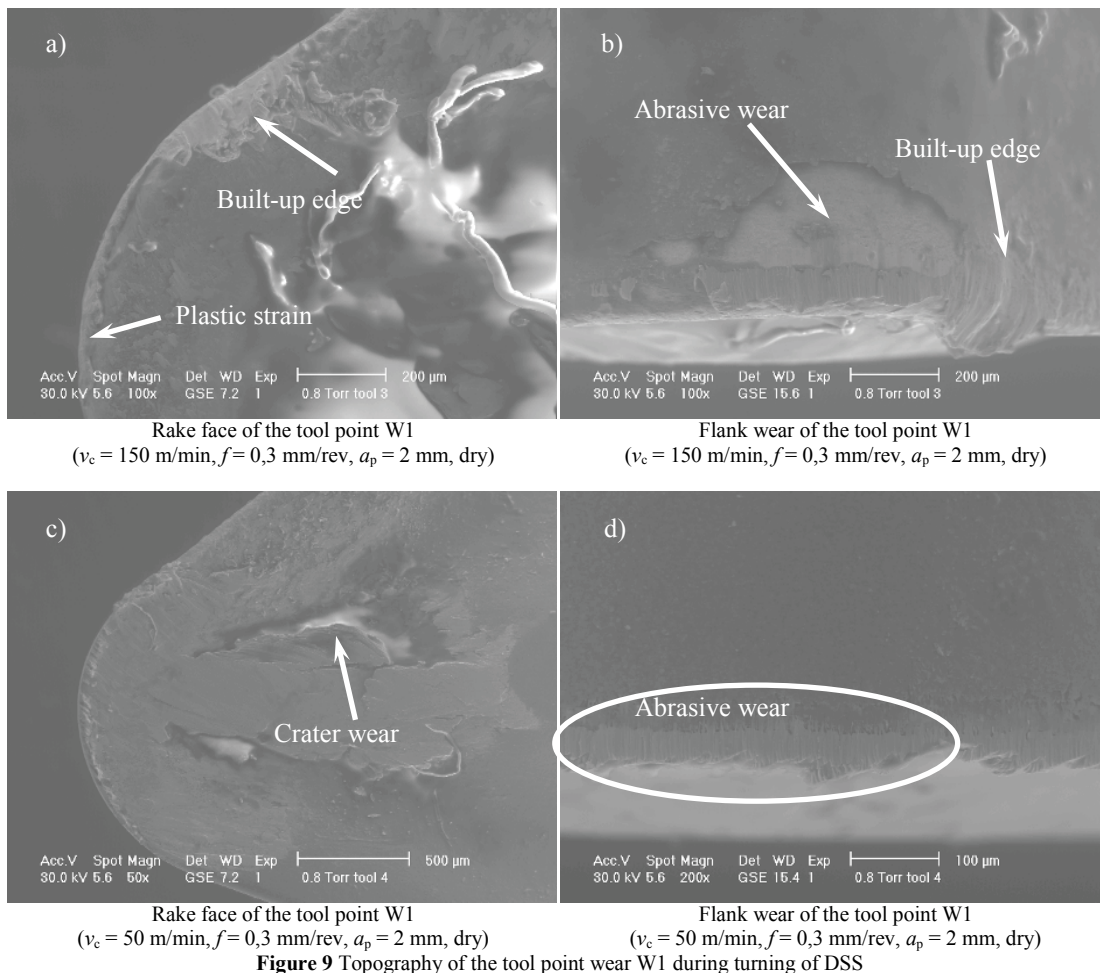


Figure 9 Topography of the tool point wear W1 during turning of DSS

3.2 Flank and rake face wear investigated by SEM analysis

In this chapter, the condition of used tool point surfaces was assessed using the corresponding SEM images shown in Fig. 9. It should be noted that Figs. 9a and 9c represent SEM surface images of the rake face, while the Figs. 9b and 9d show the flank wear. It can be

concluded that in the process of sliding friction between surfaces some DSS particles were transferred to rake face near the tool point - chip contact zone. This phenomenon was documented in Fig. 9a. These particles in the form of a built-up edge are particularly visible on the rake face of the tool point with a cutting speed of 150 m/min. For this cutting speed a small plastic deformation on the rake face

and the built-up edge with the clash of the major flank can be observed (Fig. 9b). Reducing the cutting speed to 50 m/min resulted in crater wear appearing on the rake face (Fig. 9c) and the abrasive wear of the major flank (Fig. 9d).

4 Conclusions

Based on the experimental testing of DSS machining using coated carbide tools, the following conclusions are drawn:

- 1) Increase of the cutting speed increases the intensity of wear of the cutting edge.
- 2) Flank wear was the predominant failure mode of carbide coated tool performance and the major reason of tool life reduction.
- 3) Adhesive interaction between machined and material of wedge was observed at the rake face of the tool.
- 4) Wear deviations on the cutting tool coated with a ceramic intermediate layer for parameters $v_c = 150$ m/min, $f = 0,3$ mm/rev, $a_p = 2$ mm after a time of cutting corresponding to 30 % of the tool life period in dry turning were between $-135 \mu\text{m}$ and $70 \mu\text{m}$, however for cutting speed $v_c = 50$ m/min the wear deviations range was smaller and their value was between $-5 \mu\text{m}$ and $-117 \mu\text{m}$.
- 5) The proposed method of measuring the topography of the tool point wear allows to accurately determine the wear on the rake face of the wedge.

5 References

- [1] Cabrera, J. M.; Mateo, A.; Llanes, L.; Prado, J. M.; Anglada, M. Hot deformation of duplex stainless steels. // *J. Mater. Process. Technol*, 143–144(2003), pp. 321–325.
- [2] Park, Y.H.; Lee, Z.H. // *Mater. Sci. Eng. A297* (2001), pp. 78–84.
- [3] Królczyk, G.; Gajek, M.; Legutko, S. Predicting the tool life in the dry machining of duplex stainless steel. *Eksploatacja i Niezawodność – Maintenance and Reliability*, 15, 1(2013), pp. 62–65.
- [4] Kupczyk, M. J. Manufacturing and exploitation of cutting tools with anti-wear coatings. Poznan University of Technology, Poznan, 2003 (in polish).
- [5] Astakhov, V. P. // *International Journal of Machine Tools and Manufacture*, 44, 6 (2004), pp. 637–647.
- [6] O’Sullivan, D.; Cotterell, M. // *Journal of Materials Processing Technology*, 124, 1–2 (2002), pp. 153–159.
- [7] Alicona Imaging GMBH. InfiniteFocus® version 3.2. www.alicon.com
- [8] PN-ISO 1832:1998. Indexable inserts for cutting tools. Designation.
- [9] Królczyk, G.; Legutko, S.; Gajek, M. Predicting the surface roughness in the dry machining of duplex stainless steel. // *Metalurgija*, 52, (2)(2013), pp. 259–262.

Symbols and abbreviations

a_p – depth of cut in mm
 f – feed rate in mm/rev
 r_n – rounding of the cutting edge in μm
 v_c – cutting speed in m/min
 T – tool life in min
 VB_B – width of flank wear in mm
 DSS – Duplex Stainless Steel.

Authors' addresses

Grzegorz Królczyk, PhD. Eng.

Faculty of Production Engineering and Logistics
 Opole University of Technology
 76 Prószkowska Street, 45-758 Opole, Poland
 E-mail: g.krolczyk@po.opole.pl

Stanisław Legutko, Prof. DSc. PhD. Eng., Prof. h. c.

Faculty of Mechanical Engineering and Management
 Poznan University of Technology
 3 Piotrowo Street, 60-965 Poznan, Poland
 E-mail: stanislaw.legutko@put.poznan.pl

Pero Raos, Prof. dr. sc.

J. J. Strossmayer University of Osijek
 Mechanical Engineering Faculty in Slavonski Brod
 Trg Ivane Brlić-Mažuranić 2
 35000 Slavonski Brod, Croatia
 E-mail: praos@sfsb.hr