

SGP - TR - 30



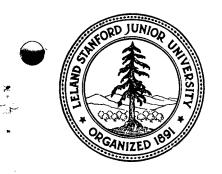

PROCEEDINGS FOURTH WORKSHOP GEOTHERMAL RESERVOIR ENGINEERING

Paul Kruger and Henry J. Ramey, Jr. Editors

December 13-15, 1978



Stanford Geothermal Program INTERDISCIPLINARY RESEARCH IN ENGINEERING AND EARTH SCIENCES Stanford University, Stanford, California

DISTRIBUTION OF THIS COOLMENT IS UNLIMITED

LOCATING THE PRODUCING LAYERS IN HGP-A

D. Kihara, B. Chen, A. Seki, and P. Yuen University of Hawaii Honolulu, Hawaii 96822

The characteristics of the Hawaii Geothermal Project well HGP-A were presented last year in terms of flow rates under throttled conditions, downhole pressure and temperature profiles, and pressure drawdown and buildup tests. In particular, the more recent pressure buildup analyses have indicated the possibility of multiple production zones. In an attempt to locate these production zones, two tests have been conducted during the past six months.

A direct means of determining the locations of the permeable layers is to measure the flow rates at the suspected depths. However, two difficulties immediately arise. Since the flow in HGP-A is a mixture of saturated liquid and vapor, the mass flow rate cannot be measured using a conventional spinner (which is a volumetric flow meter). Furthermore, the temperature encountered in the wellbore exceed the temperature limits of that instrument. To circumvent both of these difficulties, the well was allowed to produce only under severely throttled conditions. This had the effect of keeping the well fluid in a liquid state at temperatures well within the capability of the flow meter. The flow meter setup used for the production and pumpdown tests is shown in Figure 1.

The presence of a slotted liner in the bottom 4200 feet of the wellbore does not allow unequivocal interpretation of the data; however, a comparison of the maximum flow rate measured within the slotted liner and that measured at the weir on the surface shows that only a small fraction of the flow passes through the annular region outside the slotted liner.

The results for a flow meter run are shown in Figure 2. The well was producing at a flow rate of 44 gallons/minute of liquid only (22,000 lb/hr) as compared to 100,000 lb/hr of 65% quality steam at wide open conditions. This indicates that for these slow, all-liquid flow conditions, roughly 75% of the production is occurring between the depths of 4550 to 6250 feet.


The second series of tests consisted of cold water being pumped downhole at 115 gallons/minute while temperature and flow rate were monitored at selected depths. In all of the attempts,

DISCLAIMER

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency Thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

DISCLAIMER

Portions of this document may be illegible in electronic image products. Images are produced from the best available original document.

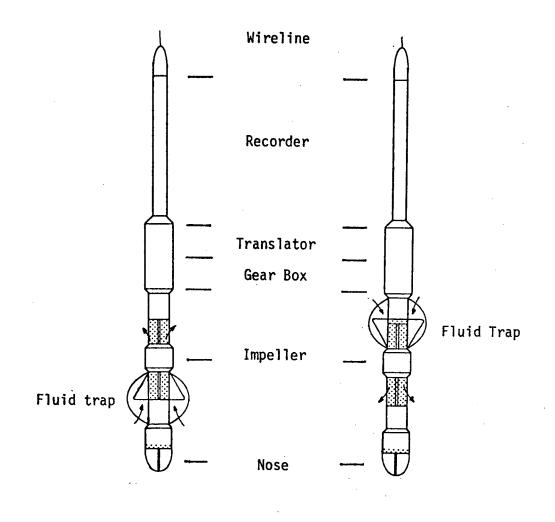


Production Flow

Pumpdown Flow

💮 Screen Material

Figure 1. Flowmeter Setup

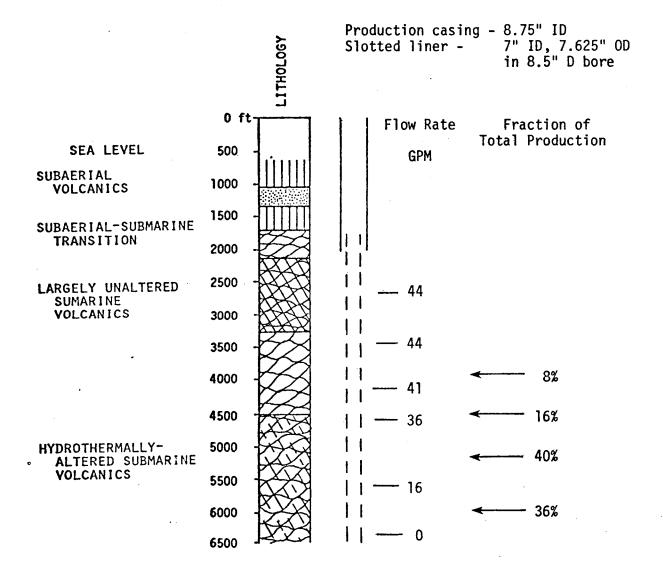



BASALTIC AA AND PAHOEHOE FLOWS BASALTIC CINDER AND SPATTER SUBMARINE BASALT FLOWS AND PILLOWS COMPLETELY- TO PARTIALLY-SEALED FRACTURE SYSTEMS

Figure 2. Summary of Flow Meter Test

-135-

a substantial amount of debris, analyzed later to be silica crystals, got past the filter screens, clogging the impeller which prevented the proper functioning of the flow meter.

The temperature profiles obtained during these tests are plotted in Figures 3 and 4. In both of these figures the temperatures measured prior to pumping (static condition A) are shown as circles while triangles and squares indicated temperatures measured while cold water was being pumped down (conditions B and C). The curve labelled (A on B) is the static temperature profile (A) moved parallel to itself so that a reasonable fit with profile (B) is obtained.

The matching of the displaced temperature profiles would lend weight to the assertion that the cold water being pumped down is pushing wellbore fluid down the wellbore and forcing the fluid back into the reservoir near bottomhole.


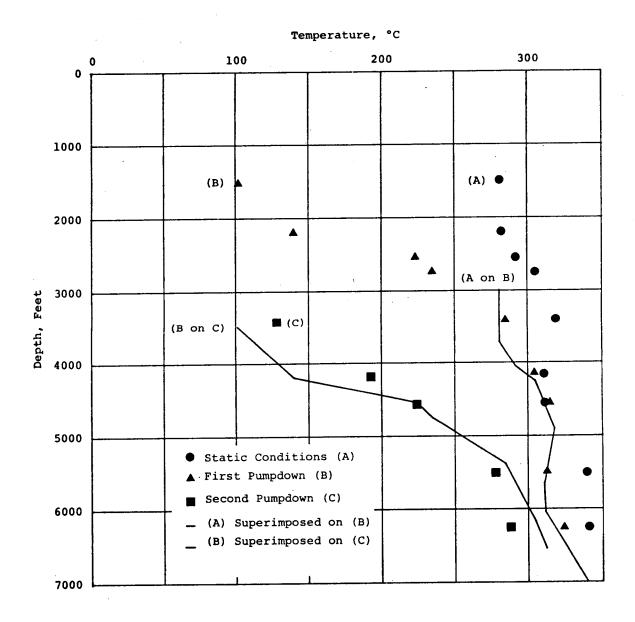


Figure 3. Results of First Pumpdown Test

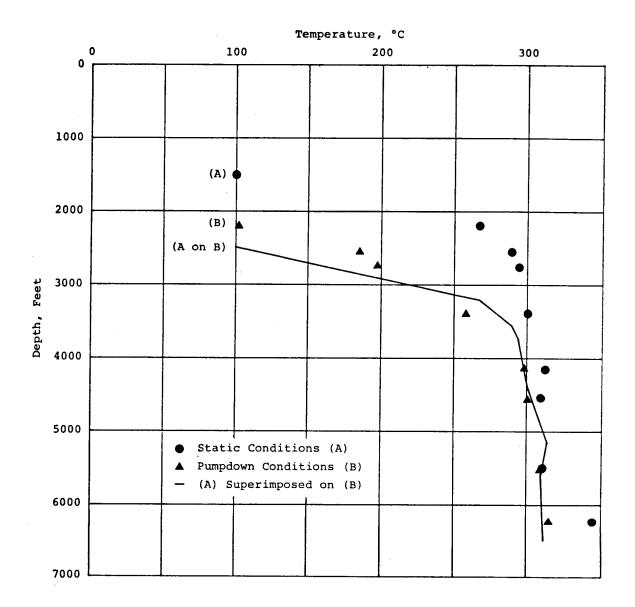

-

Figure 4. Results of Second Pumpdown Test